

VESTEL Service Bulletin

Model All models with AK28 Chassis.	<u>Service Bulletin No:</u> 118	Priority () S. All product. () A. Items in Customer / Dealer stock / Service return goods. () B. Customer stock / Units returned for Service. (X) C. Sold items returned for Service. () D. Only Units returned to this bulletin. () E. Others
SUBJECT : C216 defect		DATE : April 05, 2002

<Objective>

Please modify if following symptom occurs

<Symptom>

TV does not work due to C216 broke down

<Cause>

Because of overheating on C216.

<Countermeasures>

In order to decrease temperature on C216, modify the chassis as given below.

Replace,

C216 EL CAP 4.7 UF 250V 85°C ==> EL CAP 47 UF 250V 105°C High Ripple

<Spare Parts order>

C216: VE-30000406

<Start Date of Modification on Production.>

05.04.2002