

## T echnical T ip


FILE	TAOSC-TT-20050304-01
DATE	04 February 2005

<b>PRODUCT</b>	Scan Converter
<b>Part No:</b>	23148027


Location	Description	Part No
C184	22uF 16V (Electrolytic)	2479 4220
C187	22uF 16V (Electrolytic)	2470 4220

Repair the Scan converter board by:

- 1) Re-solder those IC Q001, Q151, Q551 and some other components if needed. (Use Lead Free Solder)
- 2) Add heat sink to IC Q001; Q151.
- 3) Replace C184, C187 as show in below photo

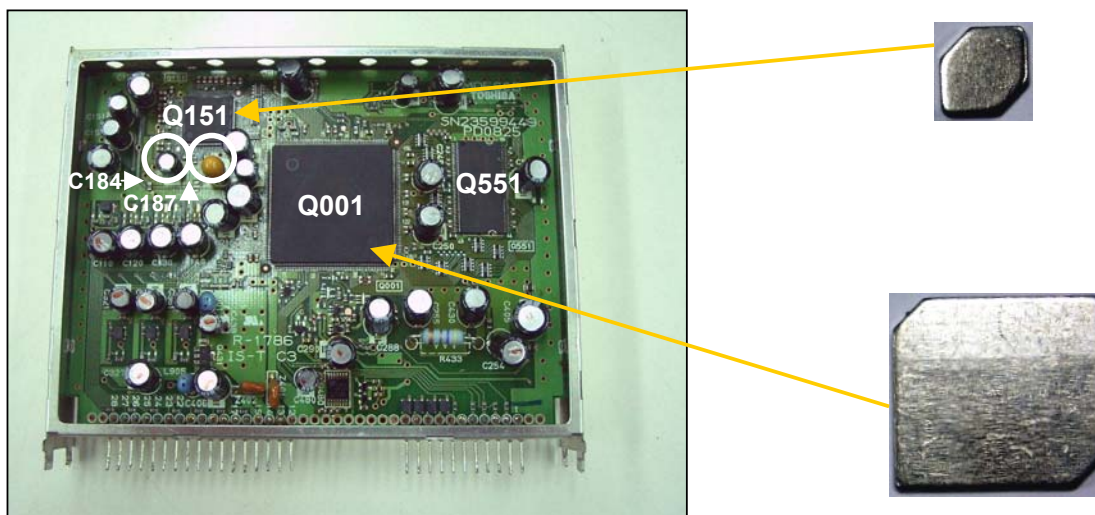

Add silicon to prevent drop off

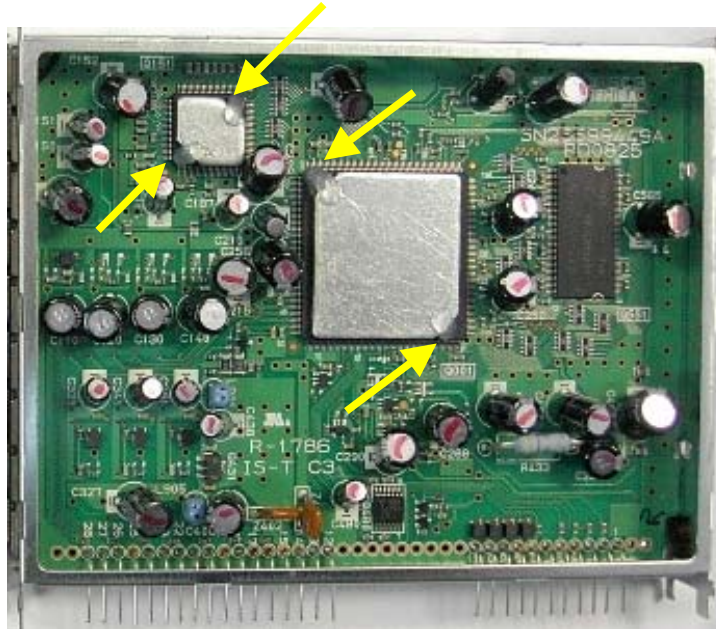

Description	Part No:
Silicone ( TSE 3843-W- Adhesive )	23960136