

Date 13.05.05	Ref. No. <b>05PV032</b>	Model <b>DCR-DVD92E, DCR-DVD202E, DCR-DVD203E, DCR-DVD403E</b>	PV
Subject <b>No Power, No Key Operation, VC Board Handling</b>			IRIS 1111 117P

## SYMPTOM

No power and no operation of various keys.

## CAUSE

Cracks in the soldering of IC2301 resulting from installing the B-to-B connector CN1107 onto the VC Board.

## SOLUTION

- Replace **IC2301** as listed in the table below.

<i>Ref.</i>	<i>Description</i>	<i>Part number</i>
IC2301	CXD3186AGG-T6	8-753-239-14

- Reinstall the B-to-B connector **CN1107** onto the VC Board as indicated below for each model.

