

VESTEL

Service Bulletin

Model:

All models with AK36
Chassis.

**Service
Bulletin No: 125**

Priority

- S. All product.
- A. Items in Customer / Dealer stock / Service return goods.
- B. Customer stock / Units returned for Service.
- C. Sold items returned for Service.
- D. Only Units returned to this bulletin.
- E. Others

SUBJECT : Q 602 defect

DATE : August 07, 2002

<Objective>

Please modify if following symptom occurs

<Symptom>

TV does not work due to Q602 broke down

<Cause>

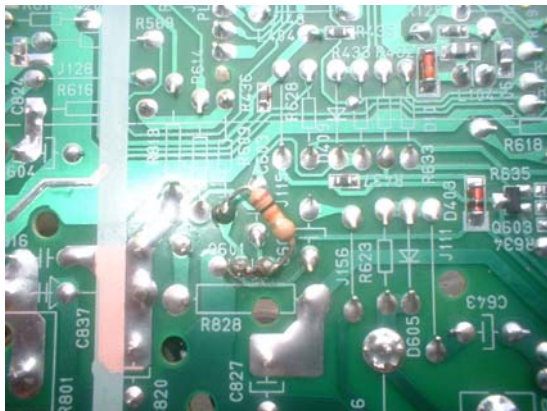
Hor. Transistor Driving Condition during switching ON/OFF.

<Countermeasures>

After changing the defected Q602,

In order to improve Q602 resistant to sparks, modify the chassis as given below.

Solder RES CF 1/4W 10K J BETWEEN BASE AND COLLECTOR OF Q601 (Hor.driver Transistor) as shown in below.

**<Spare Parts order>**

RES CF 1/4W 10K J : VE-30000471

<Start Date of Modification on Production.>

16.08.2002