



TECHNICAL INFORMATION N°2004 - 05

Chassis:

AM1480 (CRKD2103)

AM1485 (CRKD2103U)

AM2080 (CRKD2104)

AM2180 (CRKD2105)

CS350 (CRKD2118)

Symptom / Problem Observed:

The display shows "no disk".

Cause:

Impossibility of reading the new CD copy protected.

Solution:

- For models AM1480 and AM1485 :

Modification software by exchanging of integrated circuit in position IC003. New code is: 35728910.

- For models AM2080 - AM2180 and CS350 :

Change the old MP3 board Assy by a new one (PART No 35663050).

IRIS Code: The code mentioned below must be used to report the failure on the warrantee claims form; we have included it to make fault report easier and the data more reliable.

Symptom	Part code number	Qty	Position	Section	D.Code	R.Code
1 5 1 4	3 5 7 2 8 9 1 0	0 1	I C 0 0 3	A D P	Υ	Α
	3 5 6 6 3 0 5 0	0 1		A D P	Y	Α

You do not need to write anything in the white boxes.

