

SERVICE INSTRUCTION

File No.01B201002

Date: Jan 13, 2010

Product: LCD TV

Model: 32/40LV655P, 32AV655P

Subject: Software update

Symptom: No sound when tuned to specific channels

Corrective action: Update a software to the latest version (185.939)

<Procedure for Software Update>

- 1) Copy the software to USB memory (**.bin).
Place only one file on the USB.**

TV Model	File Name
32LV655P	32LV655P_SA.bin
40LV655P	40LV655P_SA.bin
32AV655P (LG panel)	32AV655P_LG.bin
32LV655P (Sharp panel)	32AV655P_SH.bin

- 2) Plug the TV to AC Socket.**
- 3) Turn on the TV, and display any TV channel.**
- 4) Unplug the TV from AC socket (If Plug the TV set to AC socket).**


5) Insert the USB memory to the USB slot (at the side of TV).




- 6) Plug the TV to AC socket.**
- 7) TV turns on automatically and starts to install the new Software.**
- 8) While installing the Software, Green LED blinks.**
- 9) When the installing is completed, Green LED stops blinking.**
- 10) Unplug the TV from AC socket.**
- 11) Remove the USB memory from the slot.**
- 12) Plug the TV to AC socket again. Quick Setup screen is displayed.**
- 13) Confirm the Software Version on Service Mode.**
 - “Service Mode“ —> “Self Check “ —> “Version Check “**

13-1) Enter Service Mode.

Press [Mute] Key twice , and at the 2nd time, hold the [Mute] key down, and press [Menu] key on the TV Side panel.

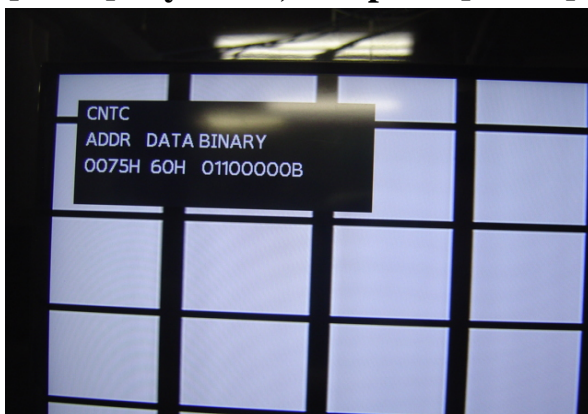

**13-2) Confirm the Software version on Version Check mode.
(On Service Mode, press [9] Key twice)**

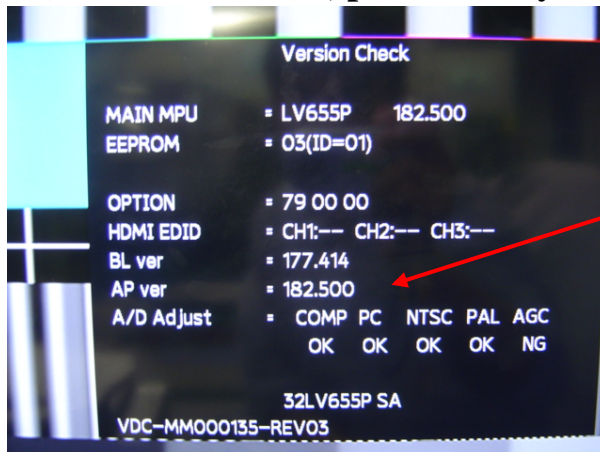

BL Ver 177.414
AP Ver 185.939 (for LV655P, AV655P)

(182.500 is old version)

14) Unplug the TV from AC socket.