


**Abstimmung 29504-003.08**  
**Tuning**  
**Sintonia**

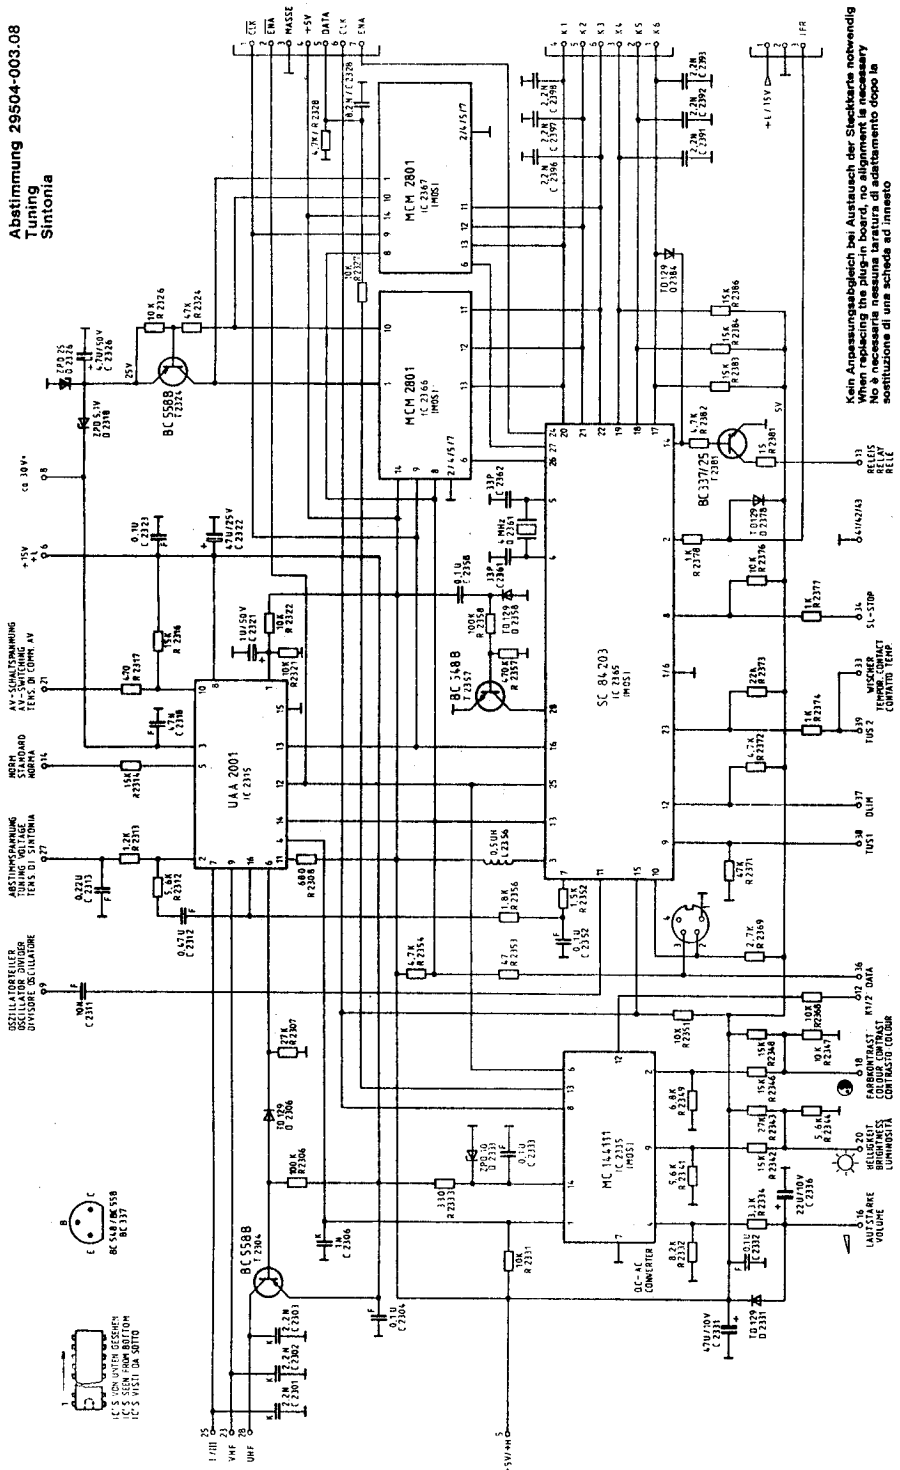

Kein Anpassungsabgleich bei Austausch der Steckkarte notwendig  
 No re-aligning the plug-in board, if alignment is necessary  
 sostituzioni di una scheda ad innesto

For Service Manuals Contact  
**MAURITRON TECHNICAL SERVICES**  
 8 Cherry Tree Rd, Chinnor  
 Oxon OX9 4QY  
 Tel:- 01844-351694 Fax:- 01844-352554  
 Email:- enquiries@mauritron.co.uk