# JVC Service Bulletin

Model	Service Manual No.	Priority		
MX-DK1		( )S.All products.		
MX-DK3	MB515	( )a.Items in JVC dealer stock/service return goods.		
MX-DK5	MB523	( )b.JVC stock/units returned for service.		
MX-DK15	MB543	( )c.Sold items returned for service.		
MX-DK51	MB543 (X)d.Only units related to this bulletin.			
		( )e.Others.		

SUBJECT: Display "Upgrade Disc" and hanged up DATE: 13.07.2006

Reasons: Programing bug

Cure: Change R3103 values from 10K to 2.2K and upgrade software.

Model	Symbol NO.	Before	After
MX-DK1/15/3/51/5	R3103	NRSA63J-103X	NRSA63J-222X

#### Recovery Method

1) Change R3101 values to new value

Refer to next page for R3103 location.

2) Upgrade software

Place upgrade CD-R onto CD tray, off AC supply & on it again.

CD tray will auto close & start reading.

Show on display "Reading" "UPGRD DISC" "UPGRADING"

It takes 7minuttes for updating.

Show on display check sum and CD tray auto open.

Release CD-R disc from CD tray ,off AC & on it again.

Parts Order: To VPT

## Upgrade data

Please get it from js net web site for technological material of AVsystem.

### http://cs.jvc-vtb.co.jp

( MX-DK series Firmware Update Procedure )

- \* Unzip the data file (double clic the zipped file), and the data file for procedure
- \* Write the data file for update in CD-R in ISO9660 format with "disc at once"

There are total 4 models in the attached files, choose the correct software when copy for upgrading. Do not copy folder but only the 2 files in it.


## **VICTOR COMPANY OF JAPAN, LIMITED.**


AV System Category Quality Management Dept. CS Group.15300


1 5 3 0 0

#### RE: MX-DK1/15/3 & CA-MXDK5/51 SERIES SET HANG-UP RECOVERY PROCEDURE


1. Change R3101 from NRSA63J-103X to NRSA63J-222X. Refer to picture below for location.




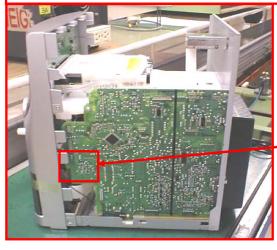

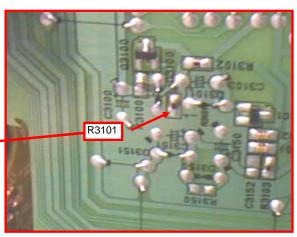

FOR MODEL CA-MXDK51 ONLY (GVA10122-A1)

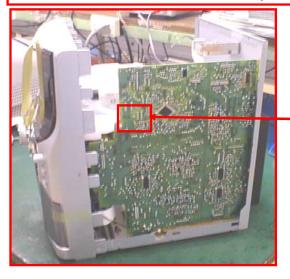

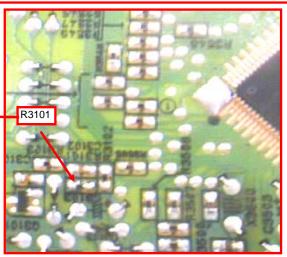

## **Cut-off serial for MX-DK series**

- MX-DK1 UN 111C0001 ~
  - UG 111C4201 ~
  - UW 111C6201 ~

  - UX 111C6701 ~ EE 111C1501 ~
- MX-DK3 UX 111C0001 ~
  - UW 111C0501 ~
  - UG 111C5201 ~
  - US 111C3001 ~
  - EE 111C0301 ~
- MX-DK15 A 111C0001 ~
- CA-MXDK5 l 111C0001 ~
  - EE111C0801 ~
- CA-MXDK51 111C0001 ~
  - U 111C0301 ~
  - U 111C0501 ~
  - EE111C0701 ~

## REMARKS:

AFTER THE REWORK SETS
WILL INDICATE " PINK COLOR DOT"
ON THE COMPUTER LABEL.